

Bulletin CQB 02-14

Subject: Front brake-clunking noise

Vehicle Involved: 2000 Mazda MPV

Condition: Excessive front caliper movement may cause a clunking noise coming from the front brakes. The noise is most evident at slow speed, brakes applied, when backing up and pulling forward repeatedly as in parking the vehicle.

Repair Procedure: Verify the customer's complaint by test-driving the vehicle. If the condition exists, replace all caliper guide plates on both sides of the vehicle. A modified Mazda part number is available LCY6-33-29Z. Lightly lubricate the metal-to-metal contact areas of the guide plates with **CARQUEST** Synthetic Moly Paste part number TMP-2.