

Product Bulletin



CARQUEST Corporation P.O. Box 26929 Raleigh, NC 27611-6929 919-573-2500 Fax 919-573-2501

Bulletin CQB 04-01

Subject: NHTSA Recall Bulletin

Vehicle Involved: 2000 Chevrolet Pickup C2500, C3500, K2500, K3500
2000 Chevrolet Silverado 1500, 2500
2000 Chevrolet S10 Pickup
2000 GMC Pickup C2500, C3500, K2500, K3500
2000 GMC Sierra 1500, 2500
2000 GMC Sonoma
Campaign Number: 00V055000
Mfg. Campaign Number: 00013

Condition:

Some of the above listed light duty vehicles equipped with 4-wheel disc brakes may have an Antilock Brake System (ABS) pump motor containing an out-of-specification spring clip. This defect spring clip may allow the pump motor bearing to become misaligned.

If misalignment occurs, the ABS system may become non-functional. The brake system then defaults to the normal base brakes. This ABS system incorporates dynamic rear proportioning (DRP). The (DRP) system optimizes front to rear brake balance. If the ABS becomes non-functional, the DRP would become inoperative as well.

Repair Procedure:

Dealers will replace the Brake Pressure Modulator valve assembly. Owners who take their vehicles to an authorized dealer on an agreed upon service date and do not receive the free remedy within a reasonable time should contact Chevrolet at 1-800-222-1020 or GMC at 1800-462-8782. If necessary contact the National Highway Traffic Safety Administration's Auto Safety Hotline at 1-888-327-4236.