

Bulletin CQB 04-12

Subject: GM front wheel speed sensor harness replacement

Vehicle Involved: 2001-2003 Buick Century, Regal
2001-2003 Chevrolet Impala, Monte Carlo
2001-2002 Oldsmobile Intrigue
2001-2004 Pontiac Grand Prix

Condition: The front wheel speed sensor harness on the above listed vehicles may come into contact with the tie rod end stud. Wear on the harness may occur causing an intermittent, or constant ABS light to be illuminated.

Repair Procedure: Replace the original equipment wheel speed sensor harnesses by splicing in the revised new harnesses available from GM dealers. The new harnesses have a different length, and have revised retention clip locations. In some cases the wheel speed sensor may have become damaged. Inspect the sensors. Detailed installation instructions are included in the kits listed below.

10340313	ABS Jumper Harness (01-03) Impala, Monte Carlo, Right
10340314	ABS Jumper Harness (01-03) Impala, Monte Carlo, Right
10340315	ABS Jumper Harness (01-04) Grand Prix, (01-02) Intrigue, Right
10340317	ABS Jumper Harness (01-04) Grand Prix, (01-02) Intrigue, Left
10340318	ABS Jumper Harness (01-03) Buick Regal, Century, Right
10340316	ABS Jumper Harness (01-03) Buick Regal, Century, Left
12089189	Crimp N' Seal Double End Connectors (X4)

