



# TECHNICAL SERVICE BULLETIN

NO. 2002

## APPLICATION

1989-95 Mazda MPV 4X4

## PART NUMBERS

9057

## SUBJECT


Front Inner Joint Vibration

## CONDITION

The splines on the stub shaft on the driver's side of the vehicle wear and create a loose connection for the inner joint. The inner joint housing will move on the stub and cause a vibration.

## SOLUTION

These splines must be lubricated with molybdenum grease. Apply 3-4 grams of molybdenum grease to the stub shaft splines prior to installation. If a vibration still persists then it may be necessary to replace the stub shaft.

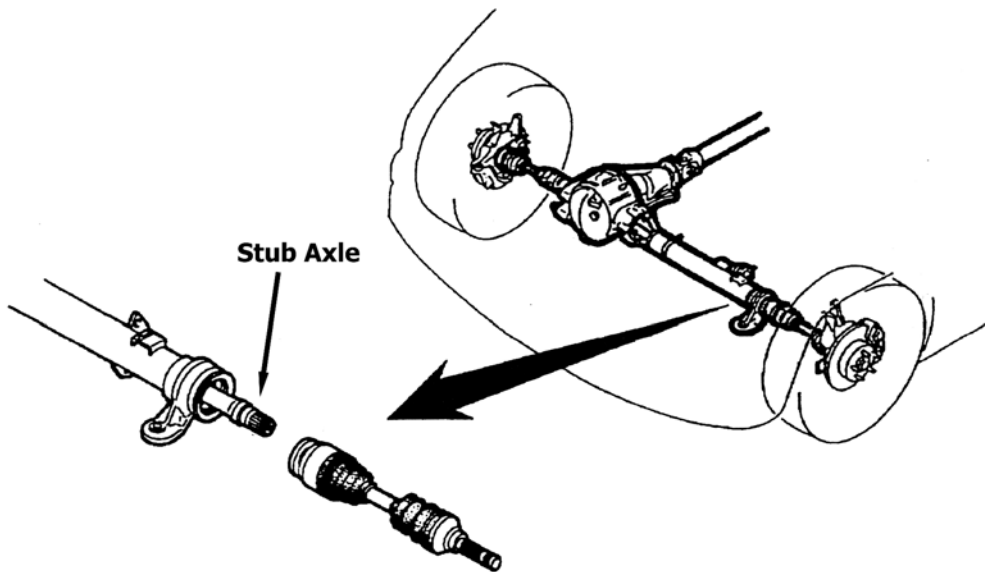

© TECH BULLETIN SUPPLIED BY:



American Remanufacturers, Inc.

TOLL FREE TECH LINE (888) 726-2234