

# PROBLEM SOLVER™ BULLETIN

BULLETIN: 25947


## Premature Ball Joint Wear

Ford Econoline Vans 1992–2004

### PROBLEM:

#### Non-serviceable joints experience premature wear in harsh fleet environments

- Requirements of fleet vehicles in the service and delivery industry impose severe demands on Ford E-Series van suspensions. Non-serviceable parts cannot support these harsh demands.

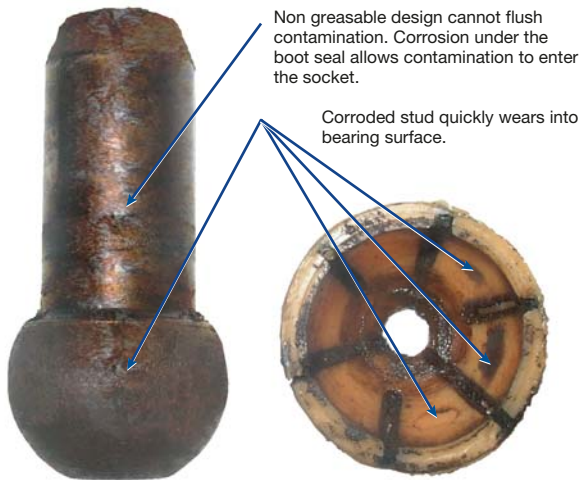

Description	Application	Replacement Part No.
Upper Ball Joint	1992–2004 Ford E-150 Econoline, E-250 Econoline and E-350 Econoline	K8608T
Lower Ball Joint	1992–2004 Ford E-250 Econoline and E-350 Econoline	K8609T
Lower Ball Joint	1992–2004 Ford E-150 Econoline	K8611T

### SOLUTION:

#### CARQUEST® K8608T, K8609T, K8611T



- The CARQUEST Chassis greaseable K8608T, K8609T and K8611T ball joints use hardened powdered metal bearings providing the most durable bearing surface available for fleet applications.
- A premium polychloroprene boot with a special grease relief valve, a patented assembly process and premium materials provides the most durable part available.

#### K8608T

Full Ball Hardened Stud

Powdered Metal "Gusher" Bearing

