

SERVICE BULLETIN

CARQUEST CORPORATION

01/00




CARQUEST FUEL PUMPS

TIP TO HELP ELIMINATE NOISE WHEN INSTALLING E7006 FUEL PUMP IN VARIOUS JEEP APPLICATIONS.

The fuel pump carrier on various Jeep applications may be equipped with a retaining ring that is not a full circle cutout. When the E7006 is installed, the retaining ring can come in contact with the top of the fuel pump causing noise to be transmitted into the passenger compartment.

To eliminate this potential problem, the installer may choose to trim out the retaining ring to allow the fuel pump to sit in the retaining ring unrestricted. Please refer to the drawing below for reference.

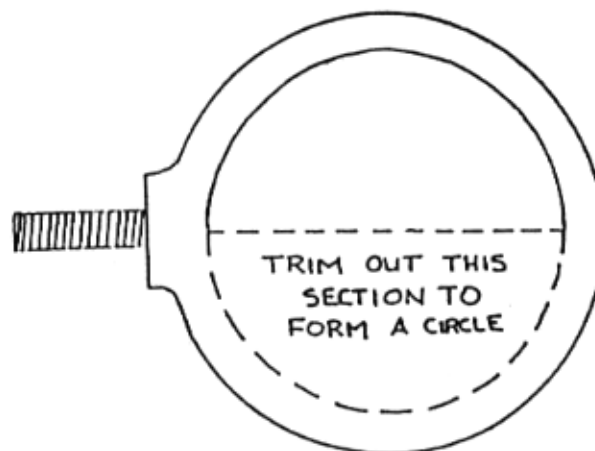

Please call 1-800-424-7839 should you require additional technical assistance.